

84630

May-17-12 11:51:06 AM

N900040100

Setup Start *NS1*

Stop *NS2*

12

Cust Item ID:

12

Customer:

Run Start *NR1*

Date:

SPC (Y/N):

Date:

NR2

[illegible]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 84630

May-17-12 11:51:06 AM

84630

Page 2

Item ID: D3538-1

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Hinge Bracket

Start Date: 17/05/2012 Start Qty: 12.00

12

Cust Item ID:

Required Date: 31/05/2012 Req'd Qty: 12.00

12

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130 QC8- Inspect parts - second check

0.00

130

QC

Memo

0.00

Quality Control

140 Chemical Conversion Coat per QSI005 4.1

0.00

140

HandFinish

Memo

0.00

Hand Finishing

150 White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

150

Powdercoat

Memo

0.00

Powder Coating

START TIME:

FINISH TIME:

OVEN TEMPERATURE:

3200F

2500

m 12/1/34

12 12/06/09

12 7/6 12-6-11

12X 12/06/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 84630

84630

Page 3

May-17-12 11:51:06 AM

Item ID: D3538-1

Accept

N9000040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Hinge Bracket

Start Date: 17/05/2012 Start Qty: 12.00

12

Cust Item ID:

Required Date: 31/05/2012 Req'd Qty: 12.00

12

Customer:

Reference:

Run Start *NR1*

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop *NR2*

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC3- Inspect Part Finish

0.00

160

QC

Memo

0.00

Quality Control

12 0 12/6-11

170

Identify as per dwg & Stock Location: 554

0.00

170

Packaging

Memo

0.00

Packaging

12 5 12/06/11

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

12/6/12

12-06-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

May-17-12 11:51:09 AM

Page 1

Work Order ID: 84630

84630

Parent Item: D3538-1

D3538-1

Parent Item Name: Hinge Bracket

Start Date: 17/05/2012

Required Date: 31/05/2012

Start Qty: 12.00

Required Qty: 12.00

Comments: IPP Rev:A New Issue 06-10.03 EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
M6061T6B1.250X01.25 0		Purchased	No			100	f	18.2900	0.19	2.4			

M6061T6B1 250X01 250

**

6061-T6 Bar 1.25 x 1.25

Location

Loc Qty

Loc Code

MAT004

18.29

→ 119318

18.29

2.4 *mk 12/06/04*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 84630
Description: Hinge Bracket		Part Number: D3538-1
Inspection Dwg: D3538	Rev: A	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
0.75	+/-0.030	.752	/		CP-2	
0.375	+/-0.010	.375	/			
0.241	+/-0.010	.245	/			
0.830	+/-0.010	.828	/			
Ø0.172	+0.005/-0.001	.172	/			
Ø0.400	+0.006/-0.001	.397	/			
0.031	+/-0.010	.030	/			
1.31	+/-0.030	1.313	/			
0.375	+/-0.010	.375	/			
0.99	+/-0.030	.99	/			
0.125	+/-0.010	.124	/			
R0.19	+/-0.030	.185	/			
0.083	+/-0.010	.083	/			
93°	+/-0.5°	93°	/			
0.674	+/-0.010	.667	/			
R0.38	+/-0.030	.38	/			
Ø0.172	+0.005/-0.001	.172	/			

Measured by: [Signature]	Audited by: [Signature]	Prototype Approval:	N/A
Date: 12.1.8	Date: 12/06/09	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	07.05.31	New Issue	KJ/JLM [Signature]	[Signature]

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			



NOTE: Date & initial all entries




DESIGN <i>LE</i>	DRAWN BY <i>LE</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3538	REV. A SHEET 1 OF 2
DATE 06.10.13	TITLE HINGE BRACKET		SCALE 1:1
REV A	DATE 06.10.13	DESCRIPTION NEW ISSUE	

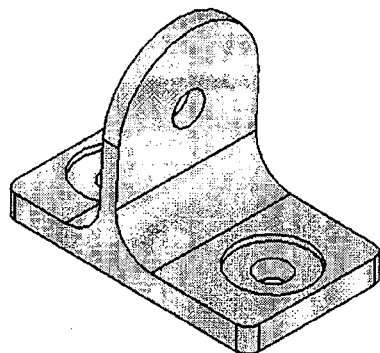

RELEASED
06.10.13

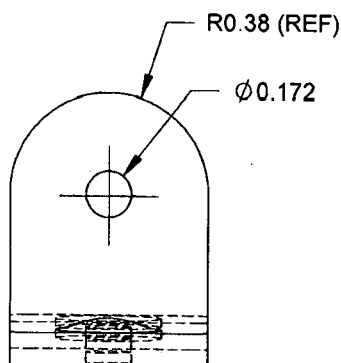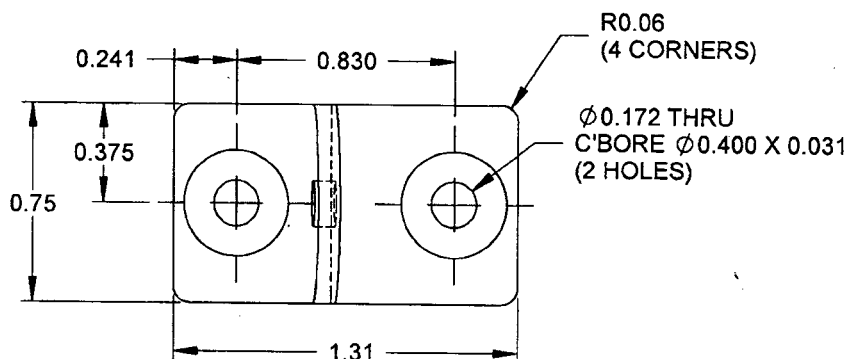

AUXILIARY VIEW A

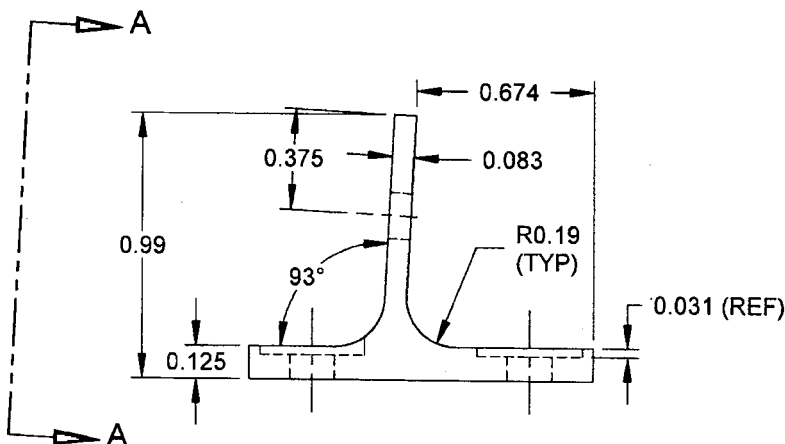

D3538-1 HINGE BRACKET

NOTES:

- 1) MATERIAL: 6061-T6 ALUMINUM PER QQ-A-225/8 OR QQ-A-200/8 (REF DART SPEC M6061T6B)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES UNLESS OTHERWISE NOTED
- 5) BREAK ALL SHARP CORNERS TO 0.010 MAX
- 6) IDENTIFY WITH P/N D3538-1 USING FINE POINT PERMANENT INK MARKER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. *27630 MLO*
12/05/17

COPYRIGHT © 2006 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			



NOTE: Date & initial all entries




DESIGN <i>LE</i>	DRAWN BY <i>LE</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3538	REV. A SHEET 2 OF 2
DATE 06.10.13	TITLE HINGE BRACKET		SCALE 1:1

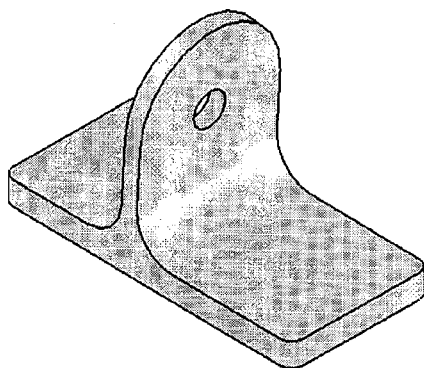

RELEASED
06.10.13

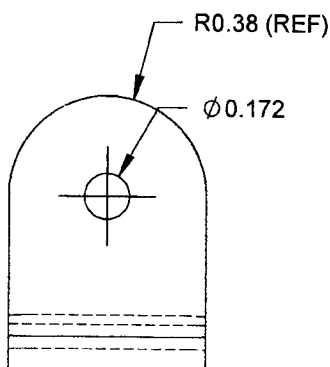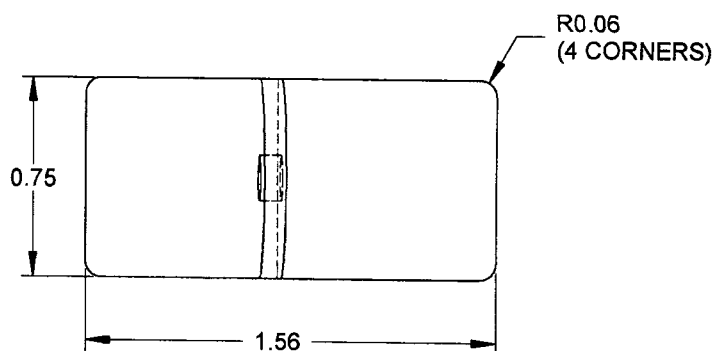

AUXILIARY VIEW B

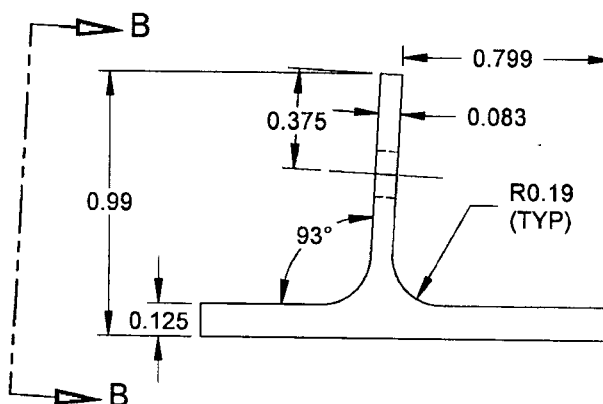

D3538-3 HINGE BRACKET

84636

NOTES:

- 1) MATERIAL: 6061-T6 ALUMINUM PER QQ-A-225/8 OR QQ-A-200/8 (REF DART SPEC M6061T6B)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES UNLESS OTHERWISE NOTED
- 5) BREAK ALL SHARP CORNERS TO 0.010 MAX
- 6) IDENTIFY WITH P/N D3538-3 USING FINE POINT PERMANENT INK MARKER

COPYRIGHT © 2006 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries